INDEPENDENT

BATTERY CERTIFICATE

AVILOO
BATTERY DIAGNOSTICS

CERTIFICATE NUMBER: 9CB89BB9-3821-48DF-9296-2D3333648F2F

VEHICLE

BRAND: Omoda
MODEL: E5 - 58,9 kWh

MILEAGE: 1,499 mi
VIN: LNNABDCX8SDJ86130
DATE AND TIME: 19/08/2026, 10:28

EXECUTED BY: Henley Cars Ltd t/a Car360

RESULTS

Independent
STATE OF HEALTH (SOH)

98.0 %

ENERGY 57kWh | 58kWh

WLTP RANGE 262mi | 267mi

RATING

BENCHMARKING
How does your vehicle compare to comparable vehicles?

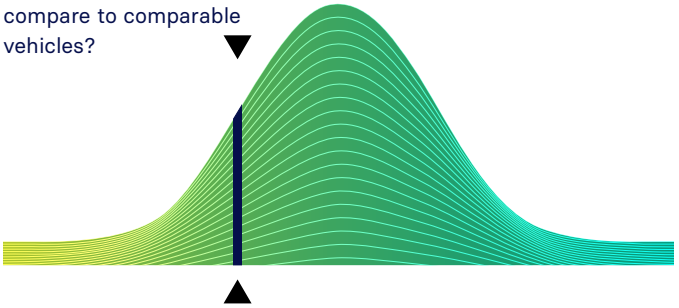

CHECKS

- Battery Management System (BMS) ✓
- Battery Sensor ✓
- Battery Measurements ✓
- Battery Cell Voltages ✓
- Vehicle Communication ✓

SCAN FOR DETAILS

EVALUATION

GOOD HEALTH - NO ABNORMALITIES DETECTED

Based on the detailed battery diagnostics performed with the AVILOO FLASH Test, we hereby certify that the drive battery of this vehicle is in good condition.

The drive battery is therefore officially AVILOO Certified.

Dr. Marcus Berger, CEO

CARA Approved Battery Health Check

BATTERY IS TESTED AND AVILOO CERTIFIED
AVILOO CERTIFIED

ENERGY

	Gross	Net (Nominal)	Usable
Current:	57.7kWh	56.7kWh	54.2kWh
New:	58.9kWh	57.9kWh	55.3kWh

RANGE

	WLTP	Typical
Current:	262mi	190mi
New:	267mi	194mi

EXECUTION PROTOCOL

AVILOO Box connected. **10:28:28**

- FLASH Test started. ✓
- Vehicle detected. ✓
- Starting data acquisition. ✓
- Finished data acquisition. ✓
- Analyzing data. ✓
- Analysis completed. ✓

SENSORS

Voltage Sensor	✓
Current Sensor	✓
Temperature Sensors	✓
Cell Voltage Sensors	✓

BMS

	Value	Status
BMS State of Charge (SoC)*:	5%	
SoC calculation accuracy:		✓
BMS State of Health (SoH)*:	97%	
SoH calculation accuracy:		✓

MEASUREMENTS

	Min	Max	Delta	Status
Battery Temperature	16.0°C	17.0°C	1.0°C	✓
Cell Voltage	3.186V	3.190V	4mV	✓
Pack Voltage	363.5V			
Average Current	-2.6A			

CELL VOLTAGES DIAGRAM

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20
1 - 20	3.188	3.189	3.189	3.189	3.190	3.189	3.188	3.189	3.190	3.190	3.189	3.189	3.189	3.189	3.189	3.187	3.188	3.187	3.189	3.188
21 - 40	3.189	3.188	3.189	3.189	3.189	3.188	3.190	3.190	3.190	3.189	3.189	3.189	3.189	3.188	3.188	3.189	3.190	3.189	3.188	3.188
41 - 60	3.186	3.188	3.187	3.187	3.188	3.188	3.189	3.188	3.187	3.187	3.188	3.188	3.189	3.188	3.189	3.189	3.189	3.189	3.189	3.190
61 - 80	3.190	3.190	3.189	3.189	3.189	3.188	3.189	3.188	3.189	3.189	3.188	3.189	3.188	3.189	3.188	3.189	3.189	3.189	3.189	3.188
81 - 100	3.188	3.189	3.189	3.189	3.189	3.189	3.188	3.189	3.188	3.188	3.188	3.189	3.189	3.189	3.189	3.189	3.188	3.189	3.189	3.189
101 - 114	3.189	3.188	3.188	3.188	3.189	3.189	3.188	3.188	3.190	3.189	3.189	3.189	3.189	3.189						

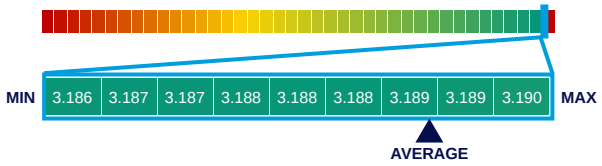

*The values shown here were read directly from the vehicle's battery management system (BMS) and are calculated and provided by the vehicle manufacturer. The State of Health (SoH) displayed corresponds to the value reported by the BMS and is CARA-certified.

DISCLAIMER: The test result includes the currently calculated state of health (SoH) of the drive battery. The determination is based on data provided by the vehicle. These are evaluated by AVILOO's algorithms using statistical and analytical models. Manipulation of the data in the control unit leads to an incorrect result. The indicated SoH has a technically induced fluctuation range (deviation) of no more than 3% in at least 95% of reference measurements. It should be noted that this tolerance applies to the SoH determination at the cell level and not to the SoH of the entire battery. This is because the state of charge of individual cells may vary, which can negatively affect the current SoH of the battery. However, this can be compensated by the Battery Managament System (BMS) or during a calibration. The result reflects the condition of the battery at the time of the test. No conclusions can be drawn about the future state of health of the battery from this. Statements about mechanical damage or external influences are not part of this diagnosis.

AVILOO GmbH | IZ NÖ-Süd, Straße 16, Objekt 69/5 | 2355 Wiener Neudorf | Austria | business.help@aviloo.com

9CB89BB9-3821-48DF-9296-2D3333648F2F